


MINI BEVELER MB-03A ASSEMBLY AND PARTS LIST

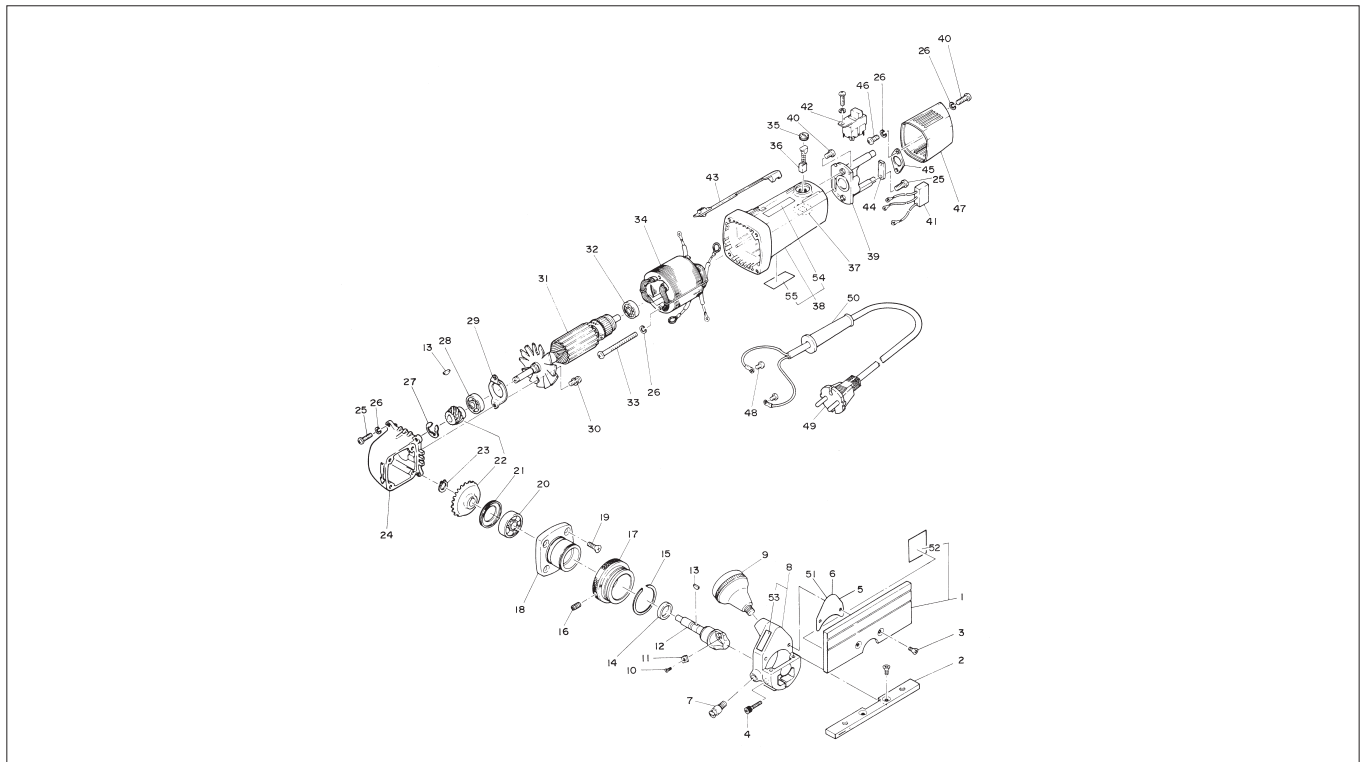

The part numbers with () are included in the Ass'y parts written above them.

No.	Part No.	Part Name	Q'ty	Price	No.	Part No.	Part Name	Q'ty	Price
1	TB02037	Plate A Ass'y	1 set		34	TA99915	Field Ass'y	1 set	
52	(TP16975)	Caution Label	1		34	TA9A444	Stator Ass'y (230V)	1 set	
2	TQ00213	Plate B	1		35	TP16213	Brush Cap	2	
3	TQ00214	Hex. Screw 5 X 12	4		36	TA9A633	Carbon Brush Ass'y (2 pcs/set)	1 set	
4	TP02863	Hex. Bolt 5 X 20	1		37	TP16266	Insulation Sheet Metal	2	
5	TP17355	Spacer 0.1	1		38	TB02038	Motor Case Ass'y	1 set	
6	TP17356	Spacer 0.2	1		54	(TP16216)	Nitto Plate	1	
7	TA9A583	Stopper Ass'y	1 set		55	(TP17358)	Specification Plate	1	
8	TB02042	Head Sub Ass'y A	1 set		39	TP16256	Insulation Stand	1	
53	(TP16361)	Warning Label	1		40	LP12832	+ Screw 4 X 14	4	
9	TA93017	Knob Ass'y	1 set		41	TP16263	Capacitor	1	
10	TP16968	Tip Setting Screw	1		41	TQ03965	Capacitor SKT (230V)	1	
11	TP17354	Tip 9.525 sq. R2	1		42	TA99917	Switch Ass'y	1 set	
12	TQ00824	Cutter Spindle	1		43	TA99916	Switch Lever Ass'y	1 set	
13	TP03755	Woodruff Key 2.5 X 10	2		44	TP16261	Cord Clamp	1	
14	TP16195	Dust Seal	1		45	TP16262	Cord Stopper	1	
15	TP16969	Retaining Ring WR-35	1		46	TA91575	+ Screw 4 X 8	2	
16	TP04827	Hex. Set Screw 6 X 10	1		47	TP16255	Motor Cover	1	
17	TP16962	Eccentric Ring	1		48	TP16292	Screw 3.5 X 8	4	
18	TP17588	Bearing Case	1		49	TA99918	Cabtyre Cord Ass'y (115V)	1 set	
19	TP00112	+ Screw 4 X 10	4		49	TB02514	Cabtyre Cord Ass'y (230V)	1 set	
20	TP01913	Ball Bearing 6000 Z	1		50	TQ03286	Strain Reliever	1	
21	TP17587	Bearing Set Screw	1		51	TP17589	Spacer 0.05	1	
22	TB01097	Pinion & Gear Ass'y	1 set			TP04696	Hex. Wrench Key 3	1	
23	TP04595	Retaining Ring C-10	1			TP01939	Hex. Wrench Key 4	1	
24	TB00609	Gear Case Sub Ass'y	1			TP16980	Spanner T-9F	1	
25	TP16208	Tapping Screw 4 X 16	6			TP17133	Hex. Screw 8 X 25	2	
26	TP04234	Washer M4	10			TP08584	Hex. Nut M8	2	
27	TQ00422	Bowed E Ring	1			TA9A639	Tip 9.525 sq. (1 pc/sheet)	1 set	
28	TP11779	Ball Bearing 629DD	1						
29	TP16252	Bearing Supporter	1						
30	TP11245	+ Screw 4 X 10	2						
31	TA99913	Armature Ass'y (115V)	1 set						
31	TA9A446	Armature Ass'y (230V)	1 set						
32	TP16251	Ball Bearing 627 ZZ	1						
33	TP16254	Screw 4 X 60	2						

OPTIONAL ACCESSORIES

	TV7A010	Cutting Tip Straight (2 pcs/set)	1 set	
	TV7A011	Cutting Tip 1/16" R (2 pcs/set)	1 set	
	TA9A594	Inner Head Ass'y	1 set	
	TA9A638	Cutting Tip 3R (10 pcs/set)	1 set	